

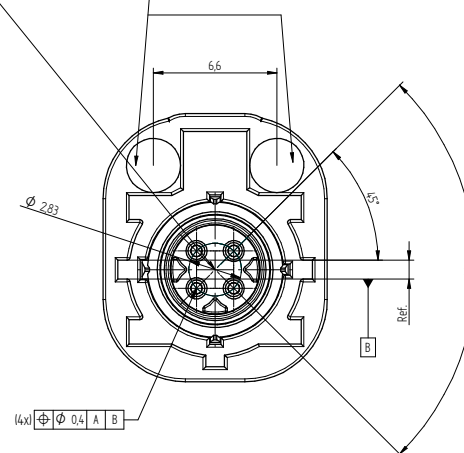
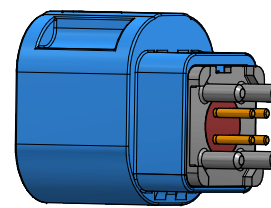
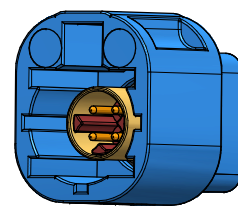
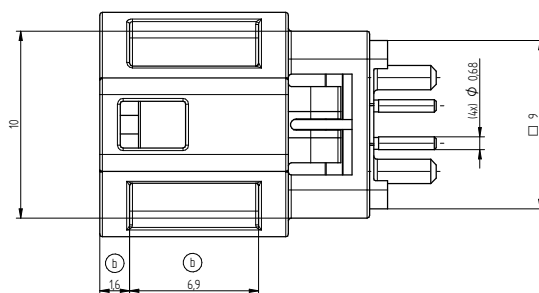
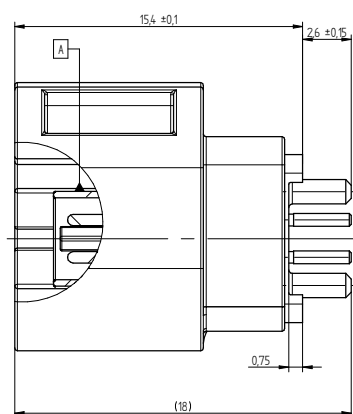
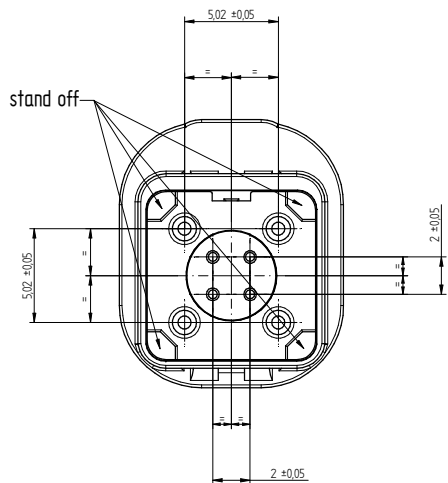


Mittelpunkt Steckerachse
Centerpoint of axis

Ansaugflächen 2 x ϕ 2,9
suction face 2 x ϕ 2,9

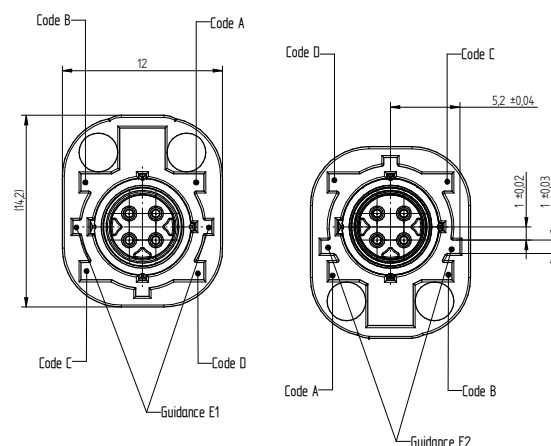

Recommended Footprint

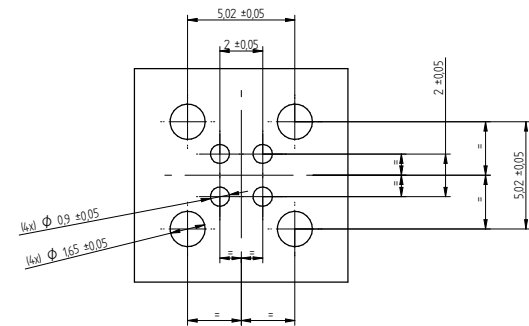

Variable X have to be stated within
the drawing number when an order is placed.

Variable X= Coding

Kodierung Coding	Plug	Farbe Color	aehnl. RAL similar to RAL
A = A-B-E1		tiefschwarz jet black	9005
B = A-C-E1		cremeweiss cream	9001
C = B-D-E1		signalblau signal blue	5005
D = C-D-E1		bordeauxviolett claret violet	4004
E = B-C-E1		laubgruen leaf green	6002
F = A-D-E1		nussbraun nut-brown	8011
Z		wasserblau water-blue	5021

Kodierung Coding	Plug	Farbe Color	aehnl. RAL similar to RAL
G = A-B-E2		blaugrau bluish gray	7031
H = A-C-E2		erikaviolett heather violet	4003
J = B-D-E2		beige beige	1001
K = C-D-E2		currygelb curry	1027
L = B-C-E2		gelbgruen yellow green	6018
M = A-D-E2		pastellorange pastel orange	2003
O		lichtgruen light green	6027

Variable Z have to be stated within
the drawing number when an order is placed

Variable Z = Plating

Part	Material	Variable Z
Housing	diecast	1 3 5 7 9
Plastic Housing	PPA	N+Sn
Centre Pin	brass	Au
Outer Contact	brass	Au
Insulator	LOP	N

IMS	DATE	REV.	SCALE
12/09/13	Frank	7:1	
5112HSD.1X10.00Z			



Scale 1:1